

USED EQUIPMENT CHECKLIST

CONTACT DETAILS

COMPANY NAME:	Concrete Pump Partners	CONTACT NAME:	Jason Pitt
STREET ADDRESS:	3950 Dickerson Pike	CITY, PROV/STATE,	Nashville, TN
PHONE:	615-476-7606	POSTAL CODE/ZIP	37207
EMAIL:	jasonpitt@pumppartners.com	COUNTRY	

TRUCK SPECIFICATIONS

YEAR:	2014	MAKE:	Mack	MODEL:	MRU 613
VIN	1M2AV09C9EM010475	ENGINE MAKE:	Volvo MP8	MILEAGE:	157,710
TRANSMISSION SPEEDS:	13	ENGINE HRS:	20,019	ENGINE HP:	505hp
TRANSMISSION TYPE:	T318 LR Maxitorque			DOES A/C FUNCTION	Yes

TRUCK: Change/Overhaul/Rebuild

New	DATE:	COMMENT:
New Mack reman engine - \$58k	10/31/2022	Work performed by Gulf Coast Truck & Equipment, Montgomery, AL
New front drive differential	February 2024	
New rear drive differential	March 2024	
New brakes and brake drums	February 2024	
Driveline inspected and repaired - \$34k	June 2021	Work performed by Big Moe Spring Alignment

SPECIFICATIONS

YEAR:	2013	BRAND:	Schwing	MODEL:	S58 SX
SERIAL #:	5800089	BOOM LENGTH:	58 meter	PUMP KIT:	2525-6
FOLD STYLE:	Roll and fold	RADIO REMOTE:	XYES <input type="checkbox"/> NO	PUMP HOURS:	Vector 13,993
PROPORTIONAL:	X YES <input type="checkbox"/> NO	CYLINDER SIZE:	10 in		

PUMP: Change/Overhaul/Rebuild

LIST:	DATE:	COMMENT:
New wear parts include: B rock valve kidney seal, carbide cutting ring, pressure spring	7/30/24	


carbide wear plate inserts mirror plate front and rear rock valve slewing shaft bushings					
Main pumps appeared to have been replaced at some point (gray in color)					
New Main Section Hollow Pin and Bushings	3/4/2021				
New diff rod packing	7/20/21				
COMPLETE EVALUATION					
		Excellent	Very Good	Good	Fair
General Operation – Pump	Check box	<input type="checkbox"/>	X	<input type="checkbox"/>	<input type="checkbox"/>
Overall Condition - Pump	Check box	<input type="checkbox"/>	X	<input type="checkbox"/>	<input type="checkbox"/>
General Operations – Truck	Check box	X	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
General Condition - Truck	Check box	X	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cab Exterior Condition:	Check box	X	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Cab Interior Condition:	Check box	X	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Front Tires:	85%				
Rear Tires:	95%				
PTO Condition:	Check box	<input type="checkbox"/>	X	<input type="checkbox"/>	<input type="checkbox"/>
PTO Value:	N/A				
Wear Part Value:	100% remaining				
Material Cylinders:	80% remaining				
Boom System:	100% remaining				
Agitator:	Check box	<input type="checkbox"/>	<input type="checkbox"/>	X	<input type="checkbox"/>
Hopper Condition:	Check box	<input type="checkbox"/>	X	<input type="checkbox"/>	<input type="checkbox"/>
Paint Condition:	Check box	<input type="checkbox"/>	X	<input type="checkbox"/>	<input type="checkbox"/>
Boom Certified:	X YES <input type="checkbox"/> NO				
Date Boom Last Inspected:	10/4/2023				
Expiry Date of last Commercial Vehicle Inspection:	January 2024				

INCLUDED WITH UNIT					
Tool Box	x YES	Tip Hose	X YES <input type="checkbox"/> NO	Outrigger Pads	X YES <input type="checkbox"/> NO
Spare Remote	X YES <input type="checkbox"/> NO	Water Hose	X YES <input type="checkbox"/> NO		

New Conforms TW deck and boom pipe installed July 2024

DATE OF EVALUATION:	7/29/24
COMPLETED BY:	C. Wideman


For questions or assistance, please contact Jason Pitt:
jasonpitt@pumppartners.com | 615-476-7606

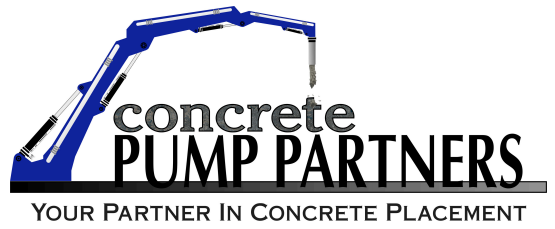

For questions or assistance, please contact Jason Pitt:
jasonpitt@pumppartners.com | 615-476-7606



For questions or assistance, please contact Jason Pitt:
jasonpitt@pumppartners.com | 615-476-7606

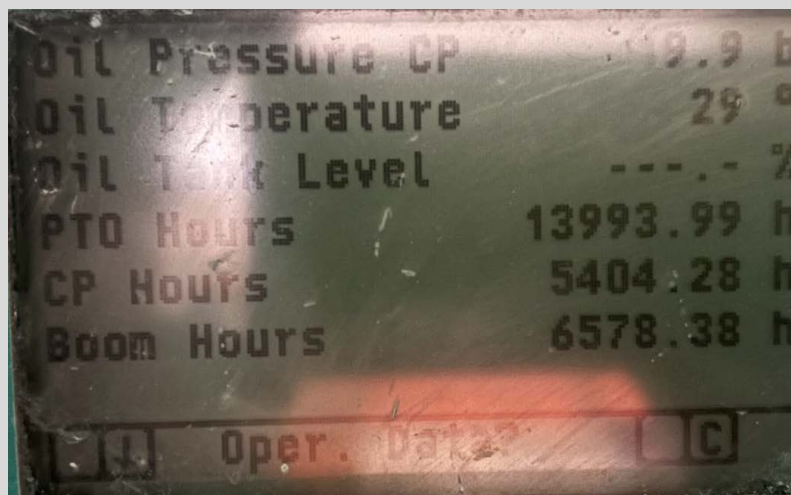

For questions or assistance, please contact Jason Pitt:
jasonpitt@pumppartners.com | 615-476-7606